

Explained: Unusual Wear Patterns and Excessive Noise on JCP4263




Juratek.com

Cause:

Counter weight / damper not fitted to caliper

Various models have a counter weight / damper fitted to the rear caliper as shown below. If this part is not fitted, it can cause unusual wear patterns on the brake pad and excessive noise during braking.

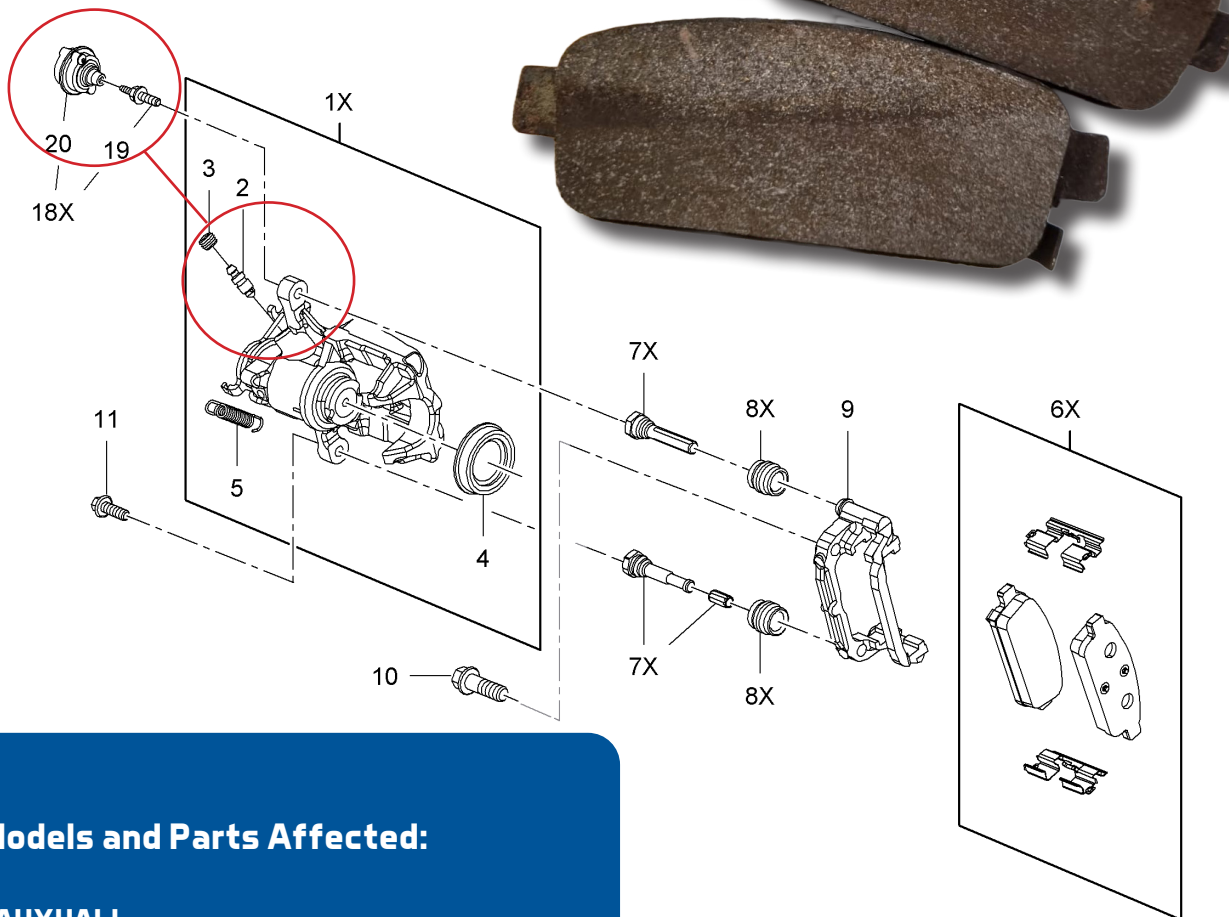

Models and Parts Affected:

VAUXHALL

ASTRA J (2010-2020)

Brake Caliper - JCA1116L / JCA1116R

Brake Pad - JCP4263

CASCADA (2013-2019)

Brake Caliper - JCA1116L / JCA1116R

Brake Pad - JCP4263

MOKKA (2013-2019) to chassis No. HB999999, H4999999

Brake Caliper - JCA1182L / JCA1182R

Brake Pad - JCP4263

MOKKA X (2013-2019) to chassis No. HB999999, H4999999

Brake Caliper - JCA1182L / JCA1182R

Brake Pad - JCP4263

ZAFIRA C (2012-2019)

Brake Caliper - JCA1116L / JCA1116R

Brake Pad - JCP4263

OE Part Required

The old caliper should have this part fitted, if this isn't present or is damaged, the OE Part number required is: **13337450** (1605260, 42372987, 1605315)

